

**2005 VX1100-D/A-D, VX110 SPORT / VX110 DELUXE
FACTORY MODIFICATION CAMPAIGN – Component Corrosion
Yamaha Technical Bulletin WR2005-009R**

Yamaha Motor Corporation, U.S.A. posts this notice as a service to Yamaha customers and potential Yamaha customers. Yamaha Motor Corporation, U.S.A. has decided that a defect relating to vehicle safety may exist in the 2005 models of the VX1100-D “VX110 Sport” and VX1100AD “VX110 Deluxe” WaveRunner® watercraft.

Affected Models

All 2005 VX1100-D VX110 Sport and VX1100A-D VX110 Deluxe

The reason for this recall: On the affected units, two components in the engine compartment may corrode in a way that could create a hazardous malfunction. Corrosion on the connector terminals of the Rectifier & Regulator Assembly can cause excessive electrical resistance. This can cause severe overheating of the wire harness coupler that connects to the Rectifier & Regulator Assembly. If this happens, there is a risk of fire, possibly resulting in personal injury to the operator, passengers, or bystanders.

What Yamaha and your dealer will do: To correct this possible defect, Yamaha is initiating a Factory Modification Campaign. For corrosion prevention, the Rectifier & Regulator Assembly must be replaced with one with improved watertight characteristics, along with a new mounting bracket for it. The Accelerator Position Sensor Assembly must be replaced with a new one that has improved watertight characteristics and a corrosion-protection coating.

What you should do now: Do not operate affected WaveRunner watercraft until they are modified.

If you are not the first owner of the watercraft and are unsure if this modification has been done, contact any authorized Yamaha Motorsports Dealer to check. Any authorized Yamaha Motorsports Dealer can perform this service. For the name and location of a dealer near you, call 1-800-88-YAMAHA or visit the Dealer Locator section of this website.